



TECH BULLETIN - INTELLEX

Date: Tuesday, February 27, 2001
Subject: Intellex, ATI Video Card

Technical Bulletin No. 120100-01

Intellex Technical Bulletin

Problem: Intellex units with no video output.

Cause: VCR, monitor or terminator is connected to the "Video In" instead of the "Composite Video Out" jack.

The Intellex system is now using a new ATI Video Card. This card has two RCA jacks.

NOTE:

- ◆ **The top RCA connector is the "Video In Jack" and is not used for Intellex.**
- ◆ **The bottom RCA connector is the "Composite Video Out" which is used to playback video to a VCR or standard composite monitor.**

If a VCR, video monitor or terminator is connected to the "**Video In Jack**" the ATI card will "**Not Enable**" the Composite Video Output and the card will appear defective, no video. Even if the connection is now moved to the "Composite Video Out", the condition will remain unchanged. The system must be **rebooted** with the output connected in order to "**Enable**" the card.

To View the Rear Panel Connectors open the following attachment and NOTE that X marks the NEVER use spot.



Fig4 Ix
RearNewATI2.pdf

Information furnished by Sensormatic is believed to be accurate and reliable. However, no responsibility is assumed by Sensormatic for its use; nor for any infringements of other rights of third parties which may result from its use. No license is granted by implications or otherwise under any patent or patent rights of Sensormatic Video Systems Division.

SENSORMATIC One Blue Hill Plaza, PO Box 1710, Pearl River, New York, 10965
Technical Support: (800) 507-6268 FAX: (845) 624-7685